

# SI-9101PW6

## DIFFERENTIAL PROBE

### USER'S MANUAL

This probe is in compliance with IEC-61010-031 CAT III, Pollution Degree 2.

## 1. Safety Terms and Symbols

Terms appear in this manual:



**WARNING.** Warning statements identify conditions or practices that could result in injury or loss life.



**CAUTION.** Caution statements identify conditions or practices that could result in damage to this product or other property.

Symbols appear on the product:



Danger  
High Voltage



Protective  
(Earth) Terminal



Attention  
Refer to Manual

## 2. General Safety Summary

Review the following safety precautions to avoid injury and prevent damage to this probe or any products connected to it.

### Observe maximum working voltage

To avoid any injury, do not use the probe above 1000Vrms CAT III between each input lead and earth or above 1000Vrms CAT III between the two leads. This voltage rating applies to both 1/10 & 1/100 settings.

**Must be grounded**

This probe is grounded with the shell of BNC connector and an auxiliary grounding terminal, through the grounding conductor of the power cord of the measurement instrument.

Before making connections to the input leads of this probe, ensure that the output BNC connector is attached to the BNC connector of the measurement instrument and the auxiliary grounding terminal is connected to a proper ground, while the measurement instrument is properly grounded.

**Use fused test prods if necessary**

If this probe is intended to use for measurements in circuits of INSTALLATION CATEGORY III, it should incorporate with fused test prods.

**Do not operate without covers**

To avoid electric shock or fire hazard, do not operate this probe with covers removed.

**Do not operate in wet/damp conditions**

To avoid electric shock, do not operate this probe in wet or damp conditions.

**Do not operate in explosive atmosphere**

To avoid injury or fire hazard, do not operate this probe in an explosive atmosphere.

**Avoid exposed circuit**

To avoid injury, remove jewelry such as rings, watches, and other metallic objects. Do not touch exposed connections and components when power is present.

**Use proper power source**

To ensure this probe function well, use four AA cells or 6VDC/200mA or regulated 9VDC/120mA mains adaptor or power lead.

**Do not operate with suspected failures**

If you suspect there is damage to this probe, have it inspected by qualified service personnel.

### 3. Description

By enabling conventional oscilloscopes to display and measure in-circuit waveforms that are referenced to high common mode voltages. The differential probe extends the measurement capability of oscilloscopes in electronic power converters, inverters, motor speed controls, switch mode power supplies and many applications.

### 4. Installation

- a. Simply plug-in the output BNC connector of this probe to the vertical input of a general purposed oscilloscope or other measurement instrument, and connects the auxiliary grounding terminal to a proper ground. The measurement instrument must have a ground referenced.

- b. Install four AA cells or connect an appropriate power source to this probe.

Select the proper attenuation ratio, when measuring signals below 70V, switch the attenuation to 1/10 in order to get higher resolution and less noise. Otherwise, set the attenuation ratio to 1/100.



---

**WARNING.** To protect against electric shock, use only the accessories supplied with this probe.

---

- c. Using the appropriate probe accessories, connect the inputs to the circuits under measurement.




---

**CAUTION.** This probe is carry out differential measurement between two points on the circuit under measurement. This probe is not for electrically insulating the circuit under measurement and the measuring instrument.

---

## 5. Appearance

The differential probe looks as follows.

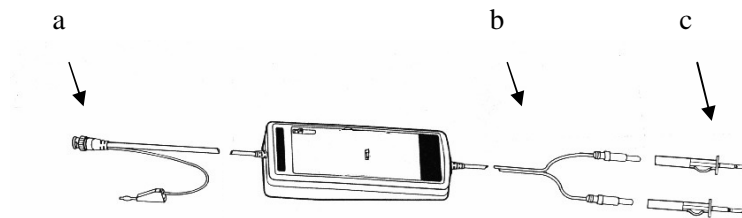


- |                 |   |
|-----------------|---|
| a. Output Cable | The output BNC connector and the auxiliary grounding terminal are connected to the oscilloscope.  |
| b. Input Leads  | The input leads of the differential probe are connected to sprung hooks that come with the probe. |
| c. Sprung Hooks | The sprung hooks are connected safely to test points in circuits under measurement.               |

## 6. Power Leads

We offer two types power leads;

- a. Lemo<sup>®</sup> Lead: For the oscilloscope whose power connector is Lemo<sup>®</sup> connector.
- b. Probus<sup>®</sup> Lead: For the oscilloscope whose power connector is Probus<sup>®</sup> connector.

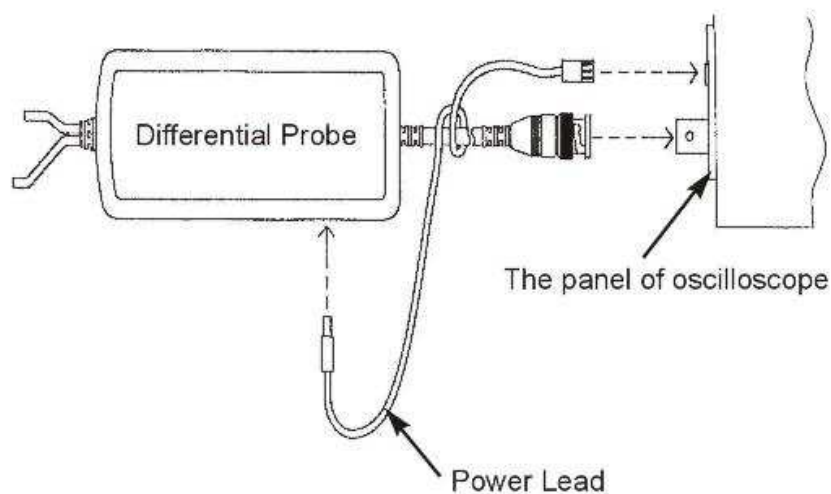

## 7. Specifications


Bandwidth	DC to 100MHz (-3dB)
Attenuation	1:10/100
Accuracy	±2%
Input Impedance	4MΩ//7pF each side to ground
Input Voltage	
- Differential Range*	±70V (DC + Peak AC) or 70Vrms @ 1/10 ±700V (DC + Peak AC) or 500Vrms @ 1/100
- Common Mode Range*	±700V (DC + Peak AC) or 500Vrms @ 1/10 & 1/100
- Absolute Max. Voltage* (Differential or Common Mode)	1000Vrms CAT III @ 1/10 & 1/100
Output Voltage	
- Swing (into 50kΩ load)	±7V
- Offset (typical)	<±5mV
- Noise (typical)	0.9mVrms
- Source Impedance (typical)	50Ω (for using 1MΩ input system oscilloscope)
CMRR (typical)	-85dB@50Hz; -55dB@1MHz
Ambient Operating Temperature	-10 to 40°C
Ambient Storage Temperature	-30 to 70°C
Ambient Operating Humidity	25 to 85% RH
Ambient Storage Humidity	25 to 85% RH
Power Requirements	
- Standard	4xAA cells or 6VDC/200mA mains adaptor** or regulated 9VDC/120mA mains adaptor**
- Options	Power leads
Length of BNC Cable	90cm
Length of Input Leads	30cm
Weight	500g
Dimension (LxWxH)	202mmx83mmx38mm

\* Voltage limit is the lesser of the DC+Peak AC and RMS values.

- \*\*
- The supplied voltage must be less than 12V and greater than 4.4V, otherwise the probe could be damaged or can not be operated properly.
  - Polarity is “+” inside and “-” outside. For wrong polarity, the probe is protected by built-in circuit, no danger or damage will occur.
  - When the voltage of the cells become too low, the power indicator on the panel will flicker.

## 8. Derating Curve

The derating curve of the absolute maximum input voltage in common mode is shown as follows;

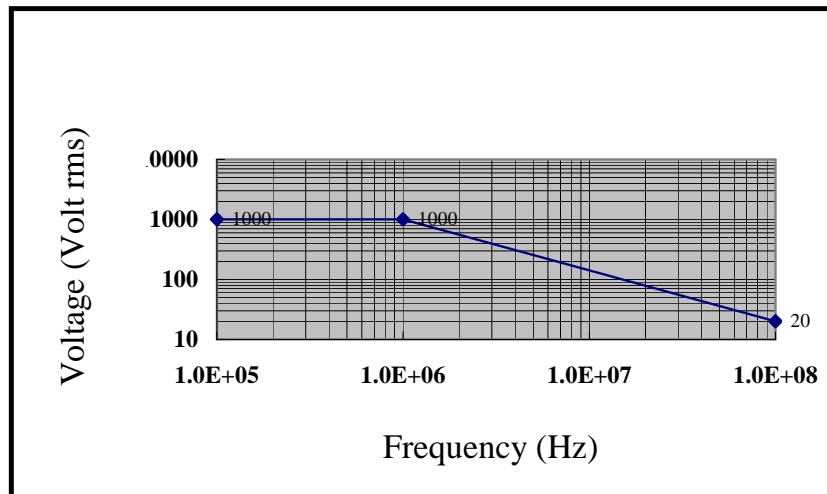

## 9. Overrange Indicator

The overrange indicator lights red if the voltage of the input signal exceeds the linear operating range of the probe. When this happens, the signal on the probe output does not accurately represent the signal on the probe input.

## 10. Inspection Procedure

- Connect the BNC output connector to the vertical input of a general purposed oscilloscope.
- Install four AA cells or connect an appropriate mains adaptor or power lead to the correct line voltage.
- Set the oscilloscope input to DC coupling and 1V/div. Center the trace on the display.
- Connect the input leads of the probe to power lines.
- Set the range of the probe to 1/10.
- Then, a 60Hz/50Hz sine-wave of proper amplitude will be displayed on the screen of the oscilloscope and this means the probe is working properly.

## 11. Cleaning

Use a soft cloth to clean the dirt. To prevent damage to the probe;

- Avoid immersing the probe.
- Avoid using abrasive cleaners.
- Avoid using chemicals contains benzene or similar solvents.

Lemo® and Probus® are registered trademarks.

Date: Mar. 12,2003

Headquarter Switzerland:  
Angst+Pfister Sensors and Power AG

Thurgauerstrasse 66  
CH-8050 Zurich  
Phone +41 44 877 35 00  
sensorsandpower@angst-pfister.com

Office Germany:  
Angst+Pfister Sensors and Power  
Deutschland GmbH  
Edisonstraße 16  
D-85716 Unterschleißheim  
Phone +49 89 374 288 87 0  
sensorsandpower.de@angst-pfister.com



## We are here for you. Addresses and Contacts.

### Sales Germany & Austria

Geometrical sensors  
Other products

Kurt Stritzelberger  
Phone +49 89 374 288 87 22  
kurt.stritzelberger@angst-pfister.com

Pressure sensors  
Other products

Gerhard Vetter  
Phone +49 89 374 288 87 26  
gerhard.vetter@angst-pfister.com

Gas sensors and modules

Peter Felder  
Phone +41 44 877 35 05  
peter.felder@angst-pfister.com

### Sales Switzerland & Liechtenstein

Postcode 3000 – 9999

Basil Frei  
Phone +41 44 877 35 18  
basil.frei@angst-pfister.com

Postcode 1000 – 2999

Christian Mohrenstecher  
Phone +41 76 444 57 93  
christian.mohrenstecher@angst-pfister.com

### Sales International Key Accounts

Peter Felder  
Phone +41 44 877 35 05  
peter.felder@angst-pfister.com

### Sales Other Countries / Product Management

Pressure Sensors  
Load Cells

Philipp Kistler  
Phone +41 44 877 35 03  
philipp.kistler@angst-pfister.com

Gas sensors  
Gas sensor modules

Dr. Thomas Clausen  
Phone +49 89 374 288 87 24  
thomas.clausen@angst-pfister.com

Flow / Level / Medical products

Dr. Adriano Pittarelli  
Phone +49 89 374 288 87 67  
adriano.pittarelli@angst-pfister.com

Power supplies

Sebastiano Leggio  
Phone +41 44 877 35 06  
sebastiano.leggio@angst-pfister.com

Linear position sensors  
Angle sensors

Eric Letsch  
Phone +41 44 877 35 14  
eric.letsch@angst-pfister.com

Accelerometers  
Sensor elements

Christoph Kleye  
Phone +49 89 374 288 87 61  
christoph.kleye@angst-pfister.com

Drive technology  
CH Postcode 5000 – 9999 / DE

Roman Homa  
Phone +41 76 444 00 86  
roman.homa@angst-pfister.com

Drive technology  
CH Postcode 1000 – 4999 / AT / IT / FR

Christian Mohrenstecher  
Phone +41 76 444 57 93  
christian.mohrenstecher@angst-pfister.com

Harald Thomas  
Phone +49 89 374 288 87 23  
harald.thomas@angst-pfister.com