


Pewatron Application Note PAN-02: Zirconia oxygen sensor;

From ppm up to 95% measurement range

The FCX zirconia oxygen sensor series comes with 4 different measurement ranges; 0...1000ppm, 0...5%, 0...25% and 0...95% (extendable to 98%). The construction of the individual sensors with respect to the measurement range have been done to meet requirements such as high accuracy, superior signal stability/ repeatability, fast response time and long operational lifetime of the sensor. The sensor output signal is in the μA range and it follows a logarithmic curve with increasing oxygen concentration.

Zirconium oxide (with proper dopant elements) when heated $> 350\text{ }^\circ\text{C}$ is penetrable for oxygen ions. The FCX oxygen series has the working point at $450\text{ }^\circ\text{C}$. The heating element and the oxygen sensing element are bonded together ensuring a perfect thermal match and minimum power usage within the working point. A voltage applied to the oxygen-sensing element, pumps the oxygen out of a closed inner chamber (Figure below). At a constant gas pressure, the quantity of oxygen pumped out is equal to the quantity of oxygen molecules diffusing in through a small capillary hole. It is independent of the voltage applied between the electrodes within a certain range. The measurement current is proportional to the quantity of oxygen molecules pumped away. The relationship between the oxygen partial pressure p_{O_2} and sensor current I_s is given by the formula $I_s = \text{constant} \times \ln(1 - p_{\text{O}_2} / p_t)$, where p_t is the total partial pressure in the system.

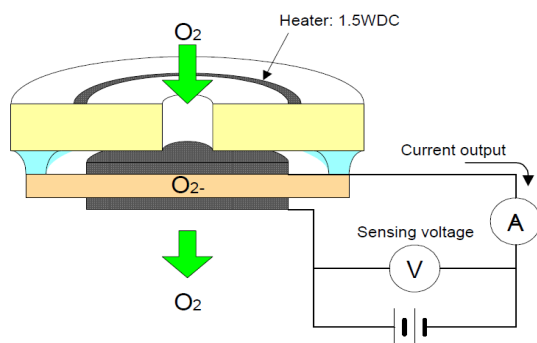

The FCX-ULL oxygen sensor measures the oxygen concentration in the range from 0...1000 ppm O_2 , but also works under normal atmospheric conditions. Sensor lifetime is limited only by the total current through the sensor element. The accuracy of the FCX-ULL sensor can be very high, but it is very much dependent on the application and how the sensor is used in the application. The standard accuracy of ± 50 ppm can be improved by calibrating the sensor before each measurement or by measuring in a continuous mode. In the latter case, the resolution can be as good as a few ppm.

The FCX-UL oxygen sensor measures the oxygen concentration in the range from 0...5% O₂, but also works under normal atmospheric conditions. Sensor lifetime, like the FCX-ULL sensor, is limited by the total current through the sensor element. For oxygen concentrations in between 0 and 10.000 ppm the accuracy of the FCX-UL sensor is very good (+/-100 ppm). For oxygen concentrations above 10.000 ppm (i.e. between 1% and 5%), the accuracy is +/-1% of the signal. As with the FCX-ULL ppm oxygen sensor, accuracy and resolution can be improved based on the applied measurement & calibration procedure by the customer.

The FCX-ULL and FCX-UL sensors are almost linear in their response to the oxygen concentration. This can be seen from the equation above, because $p_{O_2}/p_t \ll 1$. Both sensors are also very fast responding with a T₉₀ response time in order of seconds in forced flow mode.

The FCX-UC oxygen sensor measures the oxygen concentration in the range from 0...25% O₂. The response as a function of the oxygen concentration can be considered quasi-linear with a maximum error of 0.5% in the range from 13-17% oxygen. The FCX-UC oxygen sensor has a very long operational lifetime in air, and has a very stable signal output, which in turn minimizes the need for calibration. It can be calibrated in a single point and is therefore a very popular choice for oxygen transmitters in non-Ex environments.

The FCX-UWC oxygen sensor measures the oxygen concentration in the range from 0...95% O₂. It is by far the most used sensor for medical oxygen concentrators, but is also being used to measure oxygen quality/concentration in processes requiring high oxygen concentrations, like, for instance, in some controlled incubator applications. The signal stability and the accuracy at high oxygen concentration are very good, ensuring safe operation of any device based on the FCX-UWC sensor. The measurement range can be extended to 98% without loss of accuracy, but at the expense of the expected lifetime of sensor.

Headquarter Switzerland:
Angst+Pfister Sensors and Power AG

Thurgauerstrasse 66
CH-8050 Zurich
Phone +41 44 877 35 00
sensorsandpower@angst-pfister.com

Office Germany:
Angst+Pfister Sensors and Power
Deutschland GmbH
Edisonstraße 16
D-85716 Unterschleißheim
Phone +49 89 374 288 87 0
sensorsandpower.de@angst-pfister.com



We are here for you. Addresses and Contacts.

Sales Germany & Austria

Geometrical sensors
Other products

Kurt Stritzelberger
Phone +49 89 374 288 87 22
kurt.stritzelberger@angst-pfister.com

Pressure sensors
Other products

Gerhard Vetter
Phone +49 89 374 288 87 26
gerhard.vetter@angst-pfister.com

Gas sensors and modules

Peter Felder
Phone +41 44 877 35 05
peter.felder@angst-pfister.com

Sales Switzerland & Liechtenstein

Postcode 3000 – 9999

Basil Frei
Phone +41 44 877 35 18
basil.frei@angst-pfister.com

Postcode 1000 – 2999

Christian Mohrenstecher
Phone +41 76 444 57 93
christian.mohrenstecher@angst-pfister.com

Sales International Key Accounts

Peter Felder
Phone +41 44 877 35 05
peter.felder@angst-pfister.com

Sales Other Countries / Product Management

Pressure Sensors
Load Cells

Philipp Kistler
Phone +41 44 877 35 03
philipp.kistler@angst-pfister.com

Gas sensors
Gas sensor modules

Dr. Thomas Clausen
Phone +49 89 374 288 87 24
thomas.clausen@angst-pfister.com

Flow / Level / Medical products

Dr. Adriano Pittarelli
Phone +49 89 374 288 87 67
adriano.pittarelli@angst-pfister.com

Power supplies

Sebastiano Leggio
Phone +41 44 877 35 06
sebastiano.leggio@angst-pfister.com

Linear position sensors
Angle sensors

Eric Letsch
Phone +41 44 877 35 14
eric.letsch@angst-pfister.com

Accelerometers
Sensor elements

Christoph Kleye
Phone +49 89 374 288 87 61
christoph.kleye@angst-pfister.com

Drive technology
CH Postcode 5000 – 9999 / DE

Roman Homa
Phone +41 76 444 00 86
roman.homa@angst-pfister.com

Drive technology
CH Postcode 1000 – 4999 / AT / IT / FR

Christian Mohrenstecher
Phone +41 76 444 57 93
christian.mohrenstecher@angst-pfister.com

Harald Thomas
Phone +49 89 374 288 87 23
harald.thomas@angst-pfister.com